



CAMPAIGN INSTRUCTIONS

MI No. 248-2440	Date January 2004	9-3 (9440)
PI No.	Distr. all	

Customer Satisfaction Campaign 15419: Updating of software in the engine management system

Cars in stock must be rectified before delivery.

A personal communication must be sent to the owners of cars already delivered requesting them to get in touch with the nearest Saab garage as soon as possible.

Cars affected

Saab 9-3 (9440) M03 with engine variant B207E/L (150/175 hp), with automatic transmission and within Vehicle Identification Number range 31000001 - 31027500

Saab 9-3 (9440) M03 with engine variant B207R/L (210 hp), with automatic transmission and within Vehicle Identification Number range 31000001 - 31065489

Background

On cars with engine variant B207E/L (150/175 hp) the engine speed can decrease so much that in some cases the engine stops. This occurs in connection with accelerator pedal release during driving.

On cars with engine variant B207R (210 hp) the engine can stop or have uneven engine speed. This can occur if the accelerator pedal is rapidly depressed and released in a stationary car with the selector position in position D and with the engine running at idle speed.

Symptom Description

The engine stops or the engine speed varies.

Checking the modification identify plate (not US/CA)

Before proceeding, check box B2 of the modification identity plate. If the box is not marked, continue as follows:

Procedure

Install the new software according to the following table. Follow the instructions in WIS - General - TIS2000 - Technical description - Service Programming System.

TIS2000	Edition 2003-4 Update 2 or later
Software	For B207E/L (150/175 hp): 55556282 For B207R (210 hp): 55556283

Warranty/time Information:

Submit warranty claims using the following information:

Failed object: 15419

Fault/reason: 08

Location: 0

Warranty type: 02

Repair/action: 05

Labor operation: 1541901 0.7

Saab Automobile AB Bulletins are intended for use by professional Saab technicians only, NOT a "do-it-yourselfer". They are designed to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Saab trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have the condition. See your authorized Saab Dealer for information on whether your vehicle may benefit from the information.
© 2004 Saab Automobile AB. All rights reserved.

ENG



MODIFICATION INSTRUCTION

MI No. 248-2440	Date January 2004	9-3 (9440)
PI No.	Distr. all	

Updating of software in the engine management system

Customer Satisfaction Campaign 154 19

Cars in stock must be rectified before delivery.

A personal communication must be sent to the owners of cars already delivered requesting them to get in touch with the nearest Saab garage as soon as possible.

Cars affected

Saab 9-3 (9440) M03 with engine variant B207E/L (150/175 hp), with automatic transmission and within Vehicle Identification Number range 31000001-31027500

Saab 9-3 (9440) M03 with engine variant B207R (210 hp), with automatic transmission and within Vehicle Identification Number range 31000001-31064389

Background

On cars with engine variant B207E/L (150/175 hp) the engine speed can decrease so much that in some cases the engine stops. This occurs in connection with accelerator pedal release during driving.

On cars with engine variant B207R (210 hp) in some cases the engine can stop or have uneven engine speed. This can occur if the accelerator pedal is rapidly depressed and released in a stationary car with the selector lever in position D and with the engine running at idling speed.

Symptom description

The engine stops or the engine speed varies.

Checking the modification identity plate (not US/CA)

Before proceeding, check box B2 of the modification identity plate. If the box is not marked, continue as follows:

Procedure

Install the new software according to the following table. Follow the instructions in WIS - General - TIS2000 - Technical description - Service Programming System.

TIS2000	Edition 2003-4 Update 2 or later
Software	For B207E/L (150/175 hp): 55556282 For B207R (210 hp): 55556283

Marking the modification identity plate (not US/CA)

On completion of the necessary procedure, box B2 of the modification identity plate must be marked. If the work was carried out by the importer, mark the box with a "7". If carried out by a dealer, mark it with an "8".

Warranty/Time Information

See separate information.